

Date: Thursday, 5/3/2007 11:33:44 AM  
 User: Kim Johnston

## Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 412 X-TUBE INST, LOW NARROW FWD
Job Number	: 32175		
Estimate Number	: 12816		
P.O. Number	: <i>N/A</i>	Part Number	: D412664105
This Issue	: 5/3/2007 S.O. No. : <i>N/A</i>	Drawing Number	: D412-664 UNDER REV
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: <i>N/A</i> Type : LANDING GEAR	Drawing Revision	: <i>U/C</i>
Previous Run	: 32107	Material	: <i>N/A</i>
Written By	: <i>[Signature]</i>	Due Date	: 5/18/2007 Qty: 1 Um: Each
Checked & Approved By	: <i>[Signature]</i>		
Comment	: Est Rev: A New Issue 07-04-05 JLM		

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D412-664-105 CHG001

*CL* *KS 070507* <sup>①</sup>

2.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

3.0	D412664145	Crosstube 412 Low
-----	------------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Crosstube 412 Low

Batch:

*31435*

4.0	AN635A	BOLT
-----	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch:

*1103446-X*

5.0	AN636A	Bolt
-----	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch:

*1102929-X*
*[Signature]* *07/10/10*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/05/25  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 5/3/2007 11:33:44 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 412 X-TUBE INST,LOW NARROW FWD

- Job Number: 32175

Part Number: D412664105

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

MS21042L6

Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Nut

Batch: 1101660-X

7.0

AN960JD616

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Washer

Batch: 110338-X

8.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Identify and pack for shipping as per PPP D412-664-105

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 0705.75

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	32175
<b>Description:</b> Crosstube Low Narrow Fwd (412)		<b>Part Number:</b>	D412-664-105
<b>Inspection Dwg:</b> D412-664-145 <b>Rev:</b> C		<b>Page 1 of 1</b>	

Required Dimension	Min	Max
Height	19.23	19.49
1/2 Span	46.47	46.73
Angle	49°	52°
Total Span	92.94	93.46

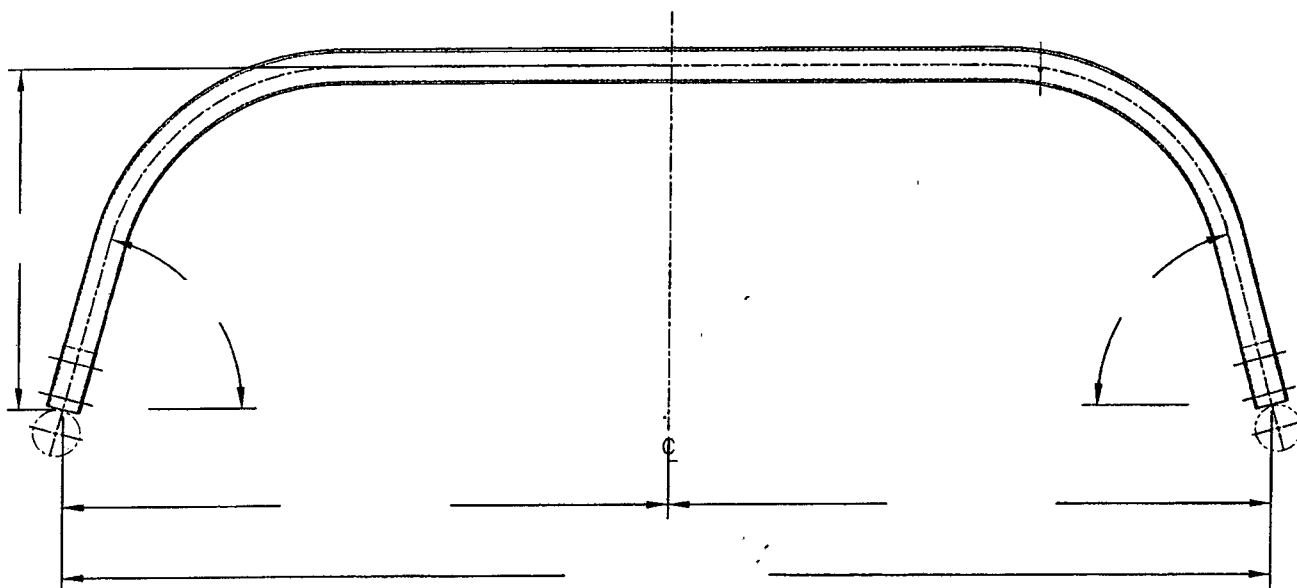

Comments

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.04.27	New Issue	KJ/JM	<i>[Signature]</i>



DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D412-664-145	REV. C SHEET 1 OF 3
DATE 07.03.29		TITLE CROSSTUBE ASS'Y (412 LOW-N FWD) NTS	
A	06.12.21	NEW ISSUE	
B	07.03.01	CHG RUBBER CUSHION	
C	07.03.29	CHG CLAMP & RUBBER CUSHION LGTH.	

RELEASED

07.04.24 *[Signature]*

**PARTS LIST:**

Qty	Part Number	Description
X	D412-664-145	CROSSTUBE ASSEMBLY (412 LOW-NARROW FWD)
1	D6019-128	CROSSTUBE
1	D2856-250-842	ABRASION STRIP
2	D2893-1	SUPPORT
1	D3189-3	CHAFING SHIELD
4	D3595-063-450	RUBBER CUSHION
2	MS21920-24	CLAMP
4	MS21920-25	CLAMP (OR MS21920-26)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)





**GENERAL NOTES:**

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6019-128  
FINISHED LENGTH = 124.48±0.020 (BEFORE BENDING/TRIMMING)
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR D3189-3 CHAFING SHIELD AND ASSOCIATED HARDWARE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-XXX-YYY ABRASION STRIPS WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
- 13) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
SECURE  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 33175

Copyright © 2006 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

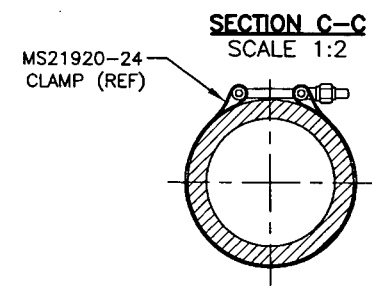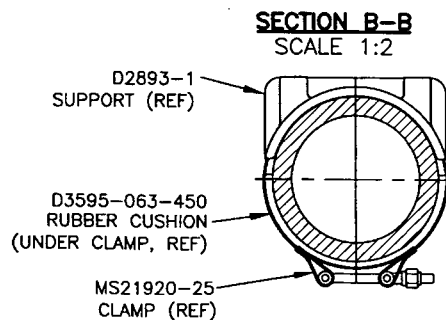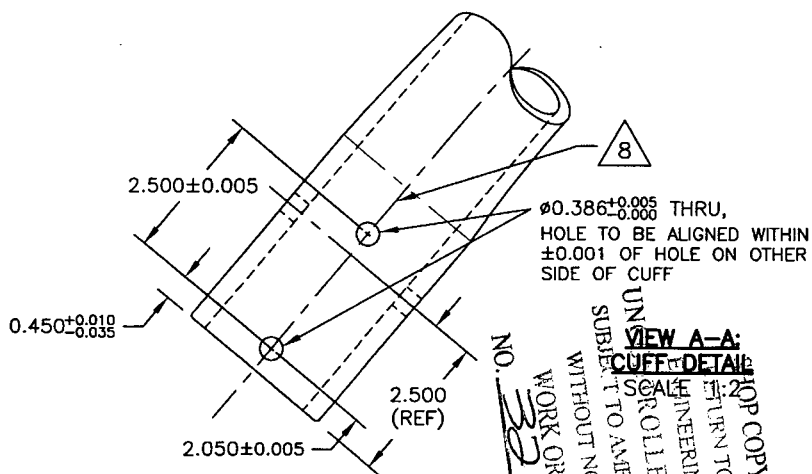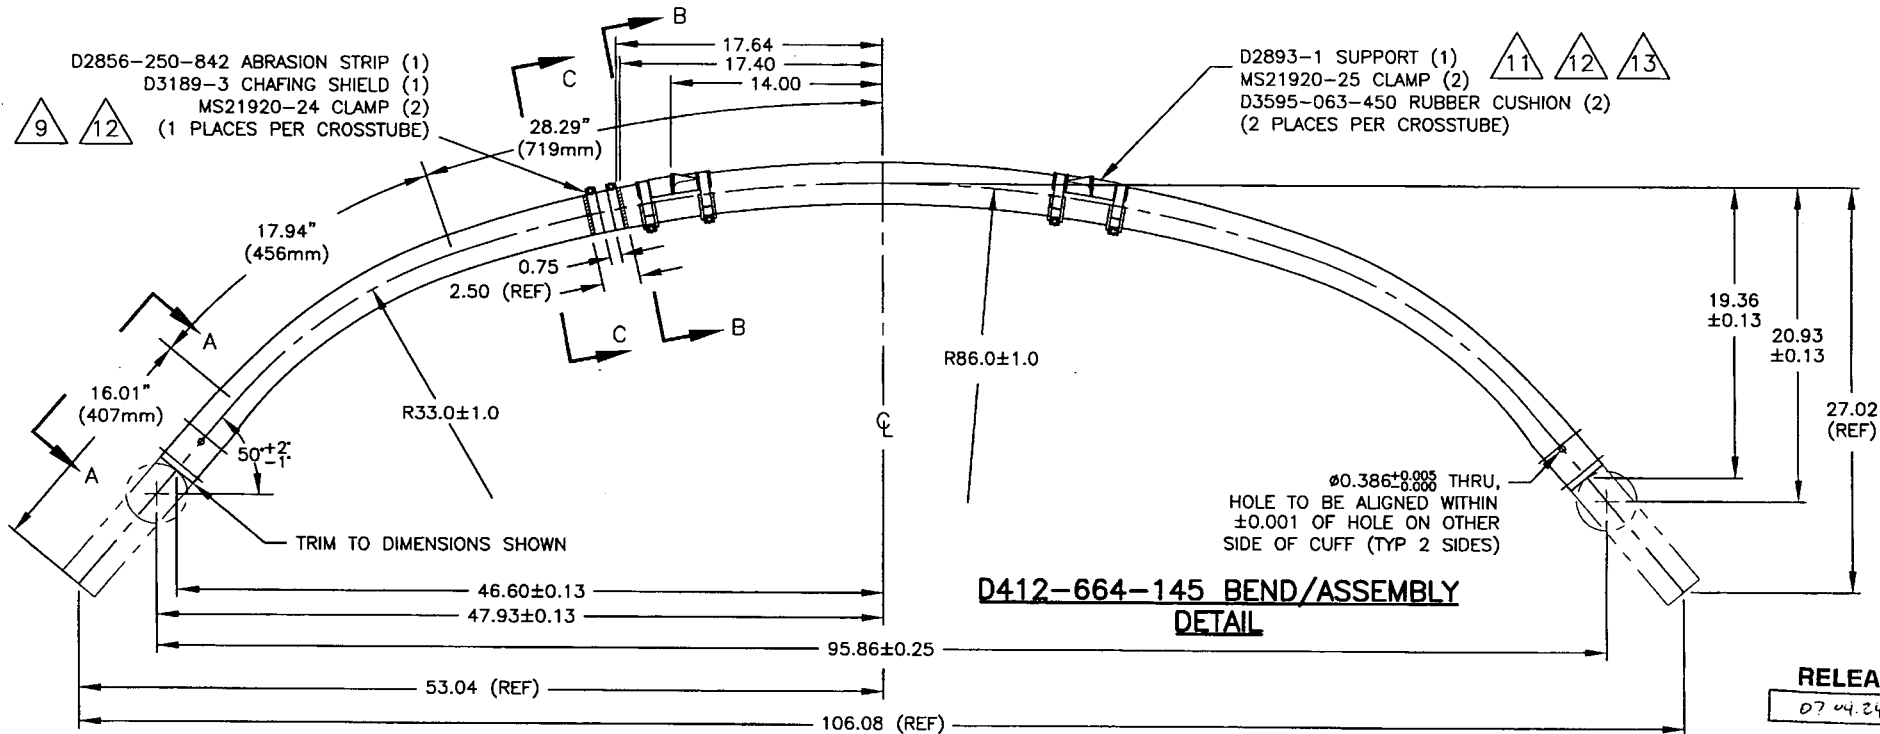

COPYRIGHT © 2008 BY DART AEROSPACE LTD.		DESIGN	90	DRAWN BY	90	<b>DART</b>	DART AEROSPACE LTD. HAMPSHIRE, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	#	APPROVED	#	DRAWING NO.	REV. C
		DATE	07.03.29			D412-664-145	SHEET 2 OF 3
						TITLE	SCALE
						CROSSTUBE (412 LOW-NARROW FWD)	1:8

